




Service Bulletin

File GE-10-118

Subject ESA-569 Clutch Plate Super 55

Date 11-16-84

Page 1 of 1

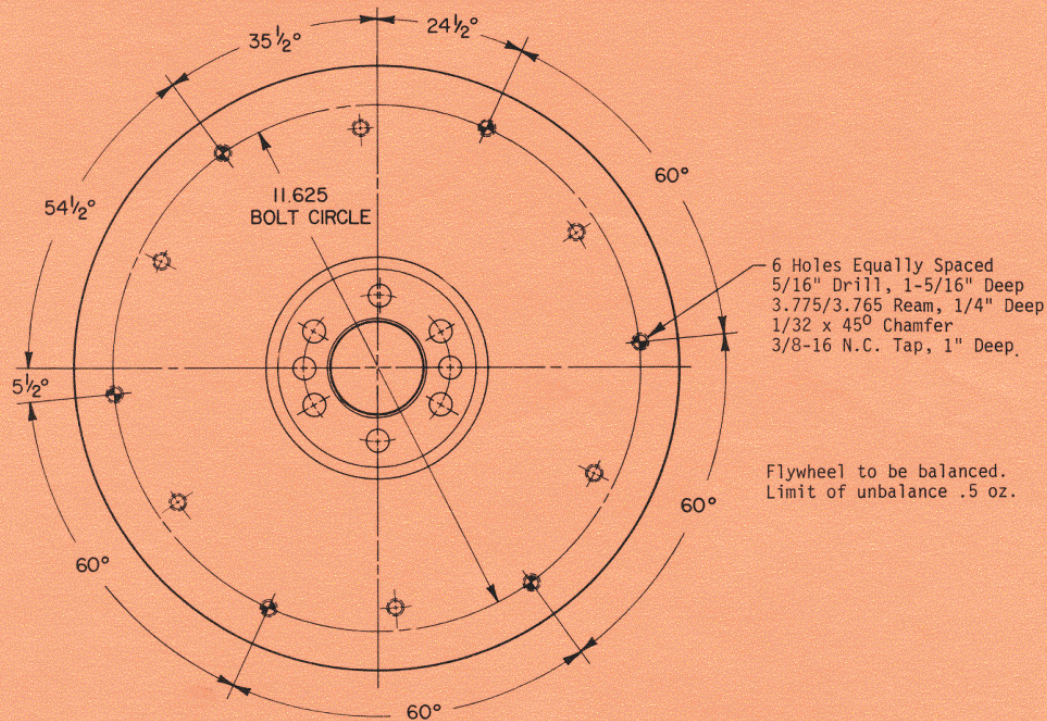

SERVICE INFORMATION

ESA-569 Clutch Plate Assembly (9-inch) has been discontinued by our supplier as a repair part and replaced by 100 691AS Clutch Plate Assembly (10-inch), 100 687AS Driven Plate (10-inch), 6 - K552 Cap Screws and 6 - 920 156 Internal Tooth Lock-washers.

In order to install larger 100 691AS Clutch Plate Assembly, flywheel must have 6 3/8-16 tapped holes in a 11.625 inch bolt circle.

If flywheel does not have these holes to accept new 10-inch clutch, flywheel must be reworked (Fig. 1) or replaced with flywheel that has 11.625 inch bolt circle.

Service Department 430 1284
VHN/ms

PARTS REPLACEMENT OR REPAIR AT COMPANY EXPENSE IS NOT AUTHORIZED UNLESS SUCH POLICY IS STATED.